
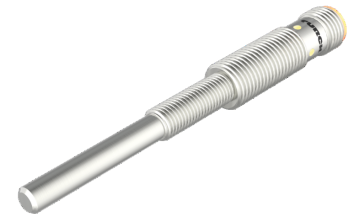


# NIMFE-M12/6.2L101-UN6X-H1141

## Magnetic Field Sensor

### For Detection of Ferromagnetic Parts

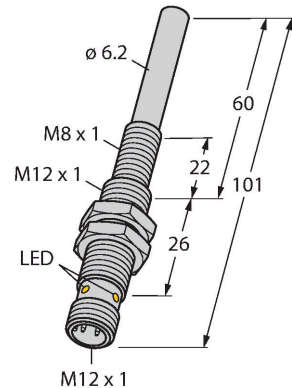


#### Technical data

Type	NIMFE-M12/6.2L101-UN6X-H1141
ID	1600611
General data	
Electrical data	
Operating voltage $U_B$	10...30 VDC
Ripple $U_{ss}$	$\leq 10 \% U_{Bmax}$
DC rated operating current $I_o$	$\leq 200 \text{ mA}$
No-load current	$\leq 15 \text{ mA}$
Residual current	$\leq 0.1 \text{ mA}$
Isolation test voltage	0.5 kV
Short-circuit protection	yes/Cyclic
Voltage drop at $I_o$	$\leq 1 \text{ V}$
Wire break/reverse polarity protection	yes/Complete
Output function	3-wire, Connection programmable, NPN
Mechanical data	
Design	Threaded barrel, M12 x 1
Dimensions	101 mm
Housing material	Metal, CuZn, Chrome-plated
Active area material	Metal, CuZn, chrome-plated
Max. tightening torque of housing nut	10 Nm
Electrical connection	Connector, M12 x 1
Environmental conditions	
Ambient temperature	-25...+70 °C

#### Features

- Threaded barrel, M12/M8
- Chrome-plated brass
- DC 3- wire, 10...30 VDC
- Programmable (NC/NO) with teach adapter VB2-SP1
- M12 x 1 connector

#### Wiring diagram

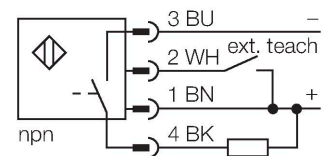

#### Functional principle


The weld sensors are available in different versions, with different signal intensities and diameters. Ferromagnetic parts which differ strongly in their material properties and diameters can thus be detected. A target part has to be located within the so called sensitive area in order to be detected. The internal sensor signal reaches the maximum intensity if the sensitive area is completely covered by the target. Partial coverage is also possible.

Sensitive area  $S = 11 \text{ mm}$   
Within this area the sensor signal changes when components are connected.

Maximum range  $M = 14 \text{ mm}$   
In case of complete coverage of the sensitive area the maximum signal intensity is achieved.


## Technical data

Vibration resistance	55 Hz (1 mm)
Shock resistance	30 g (11 ms)
Protection class	IP67
MTTF	874 years acc. to SN 29500 (Ed. 99) 40 °C
Power-on indication	LED, Green
Switching state	LED, Yellow

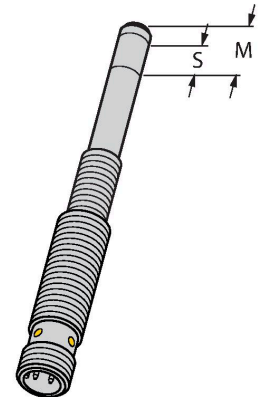

## Mounting instructions

### Mounting instructions/Description

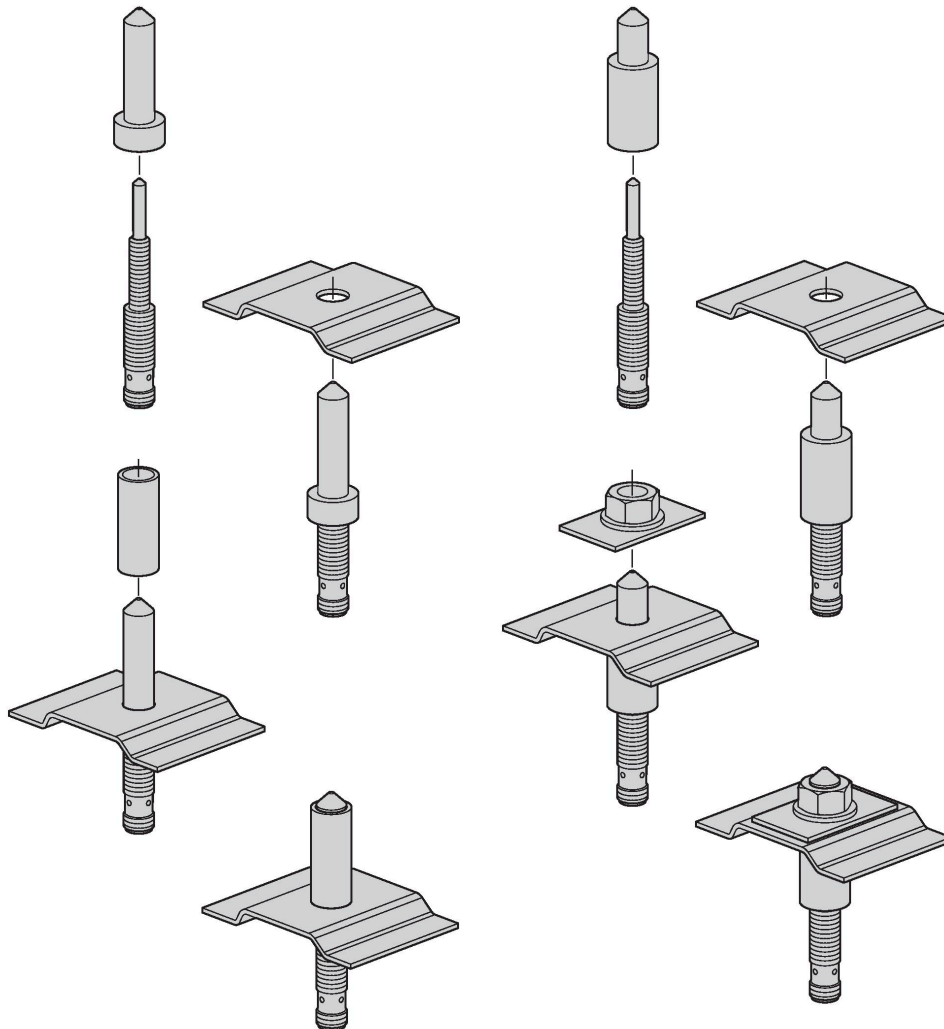

The magnetic field sensor is especially suited for the detection of welding nuts as well as spacer or reinforcing sleeves. The parts to be detected must always consist of ferromagnetic material, so that a proper function can be guaranteed. Most applications need center bolts to tack the welding nuts and reinforcing sleeves in place and thus provide mechanical protection of the sensors. These bolts have to be made of non-ferromagnetic material, like stainless steel for example. Center bolts are not available at Turck, as these have to be individually produced for and adjusted to the correspondent application.


The welding nut sensor easily detects ferritic targets with diameters between 10 mm and 20 mm.

## Accessories

BSS-12

6901321

Mounting clamp for smooth and threaded barrel sensors; material: Polypropylene

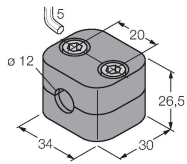

VB2-SP1

A3501-29

Teach adapter

