


NI4-EM12-VP6X-H1141



Inductive Sensor

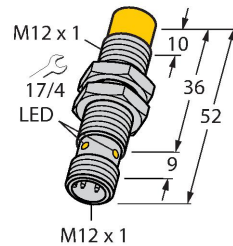

Features

- DC 4-wire, 10...30 VDC
- Changeover contact, PNP output
- M12 x 1 male connector

Wiring diagram

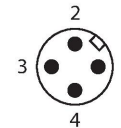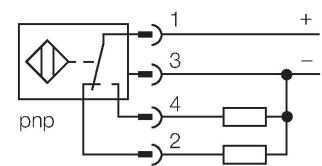

Technical data

Type	NI4-EM12-VP6X-H1141
ID	1633101
General data	
Rated switching distance	4 mm
Mounting conditions	Non-flush
Secured operating distance	$\leq (0.81 \times S_n)$ mm
Correction factors	St37 = 1; Al = 0.3; stainless steel = 0.7; Ms = 0.4
Repeat accuracy	≤ 2 % of full scale
Temperature drift	$\leq \pm 10$ %
Hysteresis	3...15 %
Electrical data	
Operating voltage U_B	10...30 VDC
Ripple U_{rs}	≤ 10 % U_{Bmax}
DC rated operating current I_o	≤ 200 mA
No-load current	≤ 15 mA
Residual current	≤ 0.1 mA
Isolation test voltage	0.5 kV
Short-circuit protection	yes/Cyclic
Voltage drop at I_o	≤ 1.8 V
Wire break/reverse polarity protection	yes/Complete
Output function	4-wire, Complementary contact, PNP
Switching frequency	2 kHz

Functional principle

Inductive sensors detect metal objects contactless and wear-free. For this, they use a high-frequency electromagnetic AC field that interacts with the target. Inductive sensors generate this field via an RLC circuit with a ferrite coil.

Technical data

Mechanical data	
Design	Threaded barrel, M12 x 1
Dimensions	52 mm
Housing material	Stainless steel, 1.4301 (AISI 304)
Active area material	Plastic, PA12-GF30
Max. tightening torque of housing nut	10 Nm
Electrical connection	Connector, M12 × 1
Environmental conditions	
Ambient temperature	-25...+70 °C
Vibration resistance	55 Hz (1 mm)
Shock resistance	30 g (11 ms)
Protection class	IP67
MTTF	2283 years acc. to SN 29500 (Ed. 99) 40 °C
Switching state	LED, Yellow

Mounting instructions

Mounting instructions/Description

The image contains three technical diagrams illustrating the mounting of a sensor. The top diagram shows a single sensor with a dimension line labeled 'T' indicating the distance from the mounting surface to the center of the sensor. The middle diagram shows two sensors mounted on a plate, with a dimension line labeled 'G' indicating the distance between the centers of the two sensors. The bottom diagram shows a sensor mounted on a plate, with dimension lines labeled 'N', 'S', 'D', and 'W' indicating various mounting parameters: 'N' is the distance from the mounting surface to the center of the sensor, 'S' is the distance from the center of the sensor to the edge of the mounting plate, 'D' is the distance from the center of the sensor to the center of the mounting plate, and 'W' is the width of the mounting plate.

Distance D	3 x B
Distance W	3 x Sn
Distance T	3 x B
Distance S	1.5 x B
Distance G	6 x Sn
Distance N	2 x Sn
Diameter active area B	Ø 12 mm


N14-EM12-VP6X-H1141 | 02/21/2025 13:40 | technical changes reserved

Accessories

BST-12B

6947212


Mounting clamp for threaded barrel sensors, with dead-stop; material: PA6

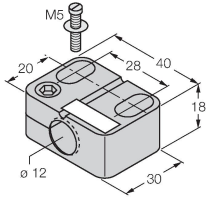

MW12

6945003

Mounting bracket for threaded barrel sensors; material: Stainless steel A2 1.4301 (AISI 304)

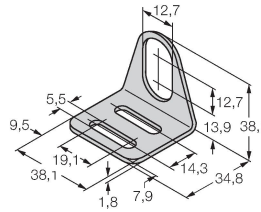

BSS-12

6901321

Mounting clamp for smooth and threaded barrel sensors; material: Polypropylene

