


NI5-K11-AN6X/S327


Inductive Sensor

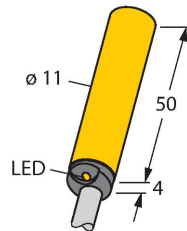

Features

- Smooth barrel, Ø 11 mm
- Plastic, PA12-GF30
- TTL output
- DC 3-wire, 10...30 VDC
- NO contact, NPN output
- Cable connection

Wiring diagram

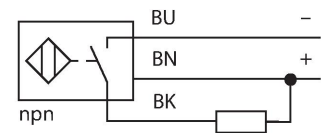

Technical data

Type	NI5-K11-AN6X/S327
ID	4661201
Special version	S327 Corresponds to:TTL output
General data	
Rated switching distance	5 mm
Mounting conditions	Non-flush
Secured operating distance	$\leq (0.81 \times S_n)$ mm
Correction factors	St37 = 1; Al = 0.3; stainless steel = 0.7; Ms = 0.4
Repeat accuracy	≤ 2 % of full scale
Temperature drift	$\leq \pm 10$ %
Hysteresis	1...3.6 %
Electrical data	
Operating voltage U_B	10...30 VDC
Ripple U_{rs}	≤ 10 % U_{Bmax}
DC rated operating current I_B	≤ 50 mA
No-load current	≤ 15 mA
Residual current	≤ 0.1 mA
Isolation test voltage	0.5 kV
Short-circuit protection	yes/Cyclic
Voltage drop at I_B	≤ 0.5 V
Wire break/reverse polarity protection	yes/Complete
Output function	3-wire, NO contact, NPN
Switching frequency	1.5 kHz

Functional principle

Inductive sensors detect metal objects contactless and wear-free. For this, they use a high-frequency electromagnetic AC field that interacts with the target. Inductive sensors generate this field via an RLC circuit with a ferrite coil.

Technical data

Mechanical data	
Design	Smooth barrel, 11 mm
Dimensions	54 mm
Housing material	Plastic, PA12-GF30
Active area material	Plastic, PA12-GF30
End cap	Plastic, EPTR
Electrical connection	Cable
Cable quality	Ø 4 mm, Gray, LifYY, PVC, 2 m
Core cross-section	3 x 0.25 mm ²
Environmental conditions	
Ambient temperature	-25...+70 °C
Vibration resistance	55 Hz (1 mm)
Shock resistance	30 g (11 ms)
Protection class	IP67
Switching state	LED, Yellow
Included in delivery	BS11

Mounting instructions

Mounting instructions/Description

The image contains three technical diagrams illustrating the mounting of the BS11 sensor. The top diagram shows a side view of the sensor (yellow cylinders) being mounted onto a panel (grey rectangle). Dimensions indicated are: N (distance between sensor centers), S (distance from sensor center to panel edge), D (distance from sensor center to mounting hole center), and W (distance from mounting hole center to panel edge). The bottom left diagram shows a top view of the sensor being inserted into a circular hole in a panel, with dimension T (hole diameter) indicated. The bottom right diagram shows a side view of the sensor being secured with a screw through the back of the panel, with dimension G (distance from sensor center to screw hole center) indicated.

Distance D	3 x B
Distance W	3 x Sn
Distance T	3 x B
Distance S	1.5 x B
Distance G	6 x Sn
Distance N	2 x Sn
Diameter active area B	Ø 11 mm

Accessories

BS 11

69462

Fixing clamp; material mounting
block: PBT

