



NI20-K40SR-FZ3X2 Inductive Sensor

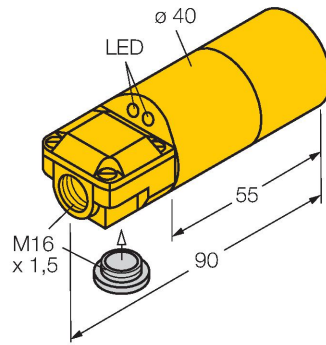

Features


- 2 cable entries (axial, radial)
- Smooth barrel, Ø 40 mm
- Plastic, ABS
- AC 2-wire, 20...250 VAC
- DC 2-wire, 10...300 VDC
- Programmable connection (NC or NO)
- Terminal chamber

Wiring diagram

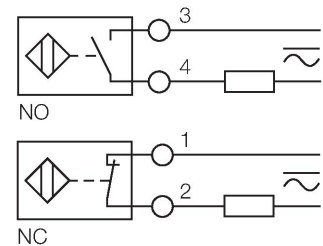

Functional principle

Inductive sensors detect metal objects contactless and wear-free. For this, they use a high-frequency electromagnetic AC field that interacts with the target. Inductive sensors generate this field via an RLC circuit with a ferrite coil.

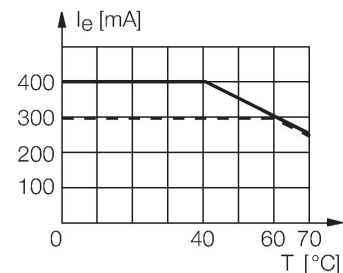

Technical data

Type	NI20-K40SR-FZ3X2
ID	13424
General data	
Rated switching distance	20 mm
Mounting conditions	Non-flush
Secured operating distance	$\leq (0.81 \times S_n)$ mm
Correction factors	St37 = 1; Al = 0.3; stainless steel = 0.7; Ms = 0.4
Repeat accuracy	≤ 2 % of full scale
Temperature drift	$\leq \pm 10$ %
Hysteresis	3...15 %
Electrical data	
Operating voltage U _B	20...250 VAC
Operating voltage U _B	10...300 VDC
AC rated operational current	≤ 400 mA
DC rated operating current I _o	≤ 300 mA
Frequency	$\geq 50 \dots \leq 60$ Hz
Residual current	≤ 1.7 mA
Isolation test voltage	1.5 kV
Surge current	≤ 8 A (≤ 10 ms max. 5 Hz)
Voltage drop at I _o	≤ 6 V
Output function	2-wire, Connection programmable, 2-wire
Smallest operating current	≥ 3 mA
Switching frequency	0.02 kHz

Technical data

Mechanical data	
Design	Smooth barrel, 40 mm
Dimensions	90 mm
Housing material	Plastic, ABS, Yellow
Active area material	Plastic, ABS, yellow
Electrical connection	Terminal chamber
Clamping ability	≤ 2.5 mm²
Environmental conditions	
Ambient temperature	-25...+70 °C
Vibration resistance	55 Hz (1 mm)
Shock resistance	30 g (11 ms)
Protection class	IP67
MTTF	2283 years acc. to SN 29500 (Ed. 99) 40 °C
Power-on indication	LED, Green
Switching state	LED, Red
Included in delivery	BS 40, cable gland, dummy plug

Mounting instructions

Mounting instructions/Description

The image contains three technical diagrams of the BS 40 sensor. The top diagram is a perspective view of the sensor mounted on a rectangular plate. It shows two yellow cylindrical sensors. Dimensions are indicated: 'N' is the distance between the sensor centers, 'S' is the distance from the sensor centers to the edge of the plate, 'D' is the distance from the sensor centers to the front edge of the plate, and 'W' is the width of the plate. The bottom-left diagram is a side view of the sensor, showing its profile and dimension 'T', which is the height of the sensor body. The bottom-right diagram is a front view showing two sensors mounted on a plate, with dimension 'G' indicating the distance between the sensor centers.

Distance D	3 x B
Distance W	3 x Sn
Distance T	3 x B
Distance S	1.5 x B
Distance G	6 x Sn
Distance N	2 x Sn
Diameter active area B	Ø 40 mm

NI20-K40SR-FZ3X2 | 02/21/2025 13-08 | technical changes reserved

Accessories

BS 40

69466

Fixing clamp; material mounting
block: PBT

