


RU40U-M18E-LI8X2-H1151

Ultrasonic Sensor – Diffuse Mode Sensor

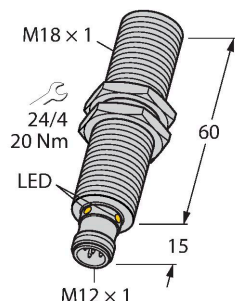


Features

- Smooth sonic transducer face
- Cylindrical housing M18, potted
- Connection via M12 x 1 male
- Teach range adjustable via adapter
- Temperature compensation
- Blind zone: 2.5 cm
- Range: 40 cm
- Resolution: 0.5 mm
- Aperture angle of sonic cone: $\pm 15^\circ$
- Analog output, 4...20 mA, additional switching output, PNP

Technical data

Type	RU40U-M18E-LI8X2-H1151
ID	1610069
Ultrasonic data	
Function	Proximity
Range	25...400 mm
Resolution	0.5 mm
Minimum measuring range	50 mm
Minimum switching range	50 mm
Ultrasound frequency	300 kHz
Repeat accuracy	$\leq 0.15\%$ of full scale
Temperature drift	$\pm 1.5\%$ of full scale
Linearity error	$\leq \pm 0.5\%$
Edge lengths of the nominal actuator	20 mm
Approach speed	≤ 3 m/s
Pass speed	≤ 1.3 m/s
Electrical data	
Operating voltage U_B	15...30 VDC
Residual ripple	10 % U_{ss}
DC rated operating current I_o	≤ 150 mA
No-load current	≤ 50 mA
Load resistance	$\leq 1000 \Omega$
Response time typical	< 60 ms
Readiness delay	≤ 300 ms

Wiring diagram

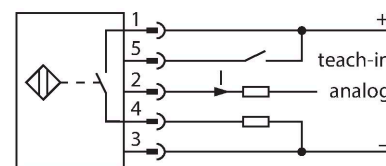

Functional principle

Ultrasonic sensors capture a multitude of objects contactlessly and wear-free with ultrasonic waves. It does not matter whether the object is transparent or opaque, metallic or non-metallic, firm, liquid or powdery. Even environmental conditions such as spray, dust or rain hardly affect their function. The sonic cone diagram indicates the detection range of the sensor. In accordance with standard EN 60947-5-7, quadratic targets in a range of sizes (20 × 20 mm, 100 × 100 mm) and a round rod with a diameter of 27 mm are used. Important: The detection ranges for other targets may differ from those for standard

Technical data

Output function	Analog output
Output 1	Analog output
Current output	4...20 mA
Load resistance current output	$\leq 0.5 \text{ k}\Omega$
Switching frequency	$\leq 10.4 \text{ Hz}$
Short-circuit protection	yes/Cyclic
Reverse polarity protection	yes
Wire breakage protection	yes
Setting option	Remote Teach

Mechanical data


Design	Threaded barrel, M18
Radiation direction	straight
Dimensions	$\varnothing 18 \times 75 \text{ mm}$
Housing material	Metal, CuZn, Nickel Plated
Max. tightening torque of housing nut	20 Nm
Transducer material	Plastic, Epoxyd resin and PU foam
Electrical connection	Connector, M12 \times 1, 5-wire
Ambient temperature	-25...+70 °C
Storage temperature	-40...+80 °C
Pressure resistance	0.5...5 bar
Protection class	IP67
Switching state	LED, Yellow
Object detected	LED, Green

Tests/approvals

MTTF	202 years acc. to SN 29500 (Ed. 99) 40 °C
Declaration of conformity EN ISO/IEC	EN 60947-5-7
Vibration resistance	20 g, 10...55 Hz, sine, 3 axes, 30 min/axis according to IEC 60068-2-6
Shock test	30 g, 11 ms, half sine, 3 axes according to IEC 60068-2-27
Approvals	CE cULus


targets due to the different reflection properties and geometries.

Sonic Cone

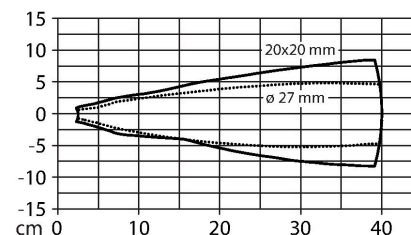

Mounting instructions

Mounting instructions/Description

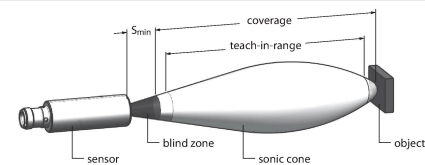

Setting the limit values
The ultrasonic sensor has an analog output with teachable measuring range. Teaching is implemented via the teach adapter. The green and yellow LEDs indicate whether the sensor has detected the object.


- Teach**
Connect the TX1-Q20L60 teach adapter between the sensor and connection cable
- Position object for remote limit value
 - Press the button against Ub for 2 - 7 seconds
 - Position object for close limit value
 - Press the button against Ub for 8 - 11 seconds
- Optional: Inversion of analog output
- Press the button for 12 - 17 seconds

LED response
Successful teaching is displayed with a fast flashing LED. Thereafter, the sensor automatically runs in normal operating mode. Unsuccessful teaching is indicated by the LED flashing alternately green and yellow. In normal operation, the two LEDs indicate the status of the sensor.

- Green: Object within the detection range, but not in the measuring range
- Yellow: Object is within the measuring range
- Off: Object outside the detection range or signal loss

Accessories


MW18 6945004

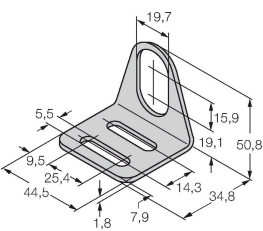

Mounting bracket for threaded barrel sensors; material: Stainless steel A2 1.4301 (AISI 304)


Wiring accessories

Dimension drawing	Type	ID	
	RKC4.5T-2/TEL	6625016	

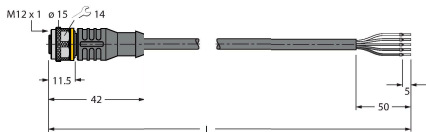

Connection cable, M12 female connector, straight, 5-pin, cable length: 2 m, jacket material: PVC, black; cULus approval

Dimension drawing	Type	ID	
	WKC4.5T-2/TEL	6625028	Connection cable, M12 female connector, angled, 5-pin, cable length: 2 m, jacket material: PVC, black; cULus approval

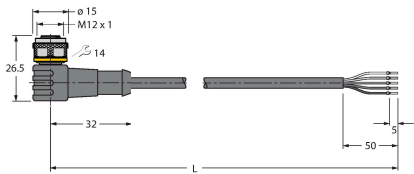

Accessories

Dimension drawing	Type	ID	
	TX1-Q20L60	6967114	Teach adapter for inductive encoders, linear position, angle, ultrasonic and capacitive sensors

